

Manhasset Union Free School District

**Districtwide Lead in Drinking Water
Sampling and Remediation Plan**

2020



ENVIROSCIENCE
CONSULTANTS INC.

**2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191
www.envirohealth.org**

Project #19488

Districtwide Lead in Drinking Water
Sampling and Remediation Plan

Performed for:

Manhasset Union Free School District
200 Memorial Place
Manhasset, NY 11030

December 2020

Prepared by:

Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191

Project #19488

President



Glenn Neuschwender

Districtwide Lead in Drinking Water Sampling and Remediation Plan

Table of Contents

I. Executive Summary

II. Sampling Methodology

III. Initial Results

Appendix A – Manhasset Secondary School

Appendix B – Munsey Park Elementary School

Appendix C – Shelter Rock Elementary School

January 26, 2021

Fred Bruder
Manhasset UFSD
200 Memorial Place
Manhasset, NY 11030

I. Executive Summary

The Manhasset Union Free School District has developed their 2020 Lead in Drinking Water Sampling and Analysis Program, as required by the New York State Department of Health (Public Health Law Sections 1370-a and 1110, Subpart 67-4 Lead Testing in School Drinking Water).

In accordance with the regulation, this Lead Remediation Plan is prepared to identify locations deemed as Applicable Drinking Water Sources and report first draw sample results, to mitigate locations where sample results exceed 15 parts per billion, to identify locations deemed as Non-Applicable Water Sources, communicate this designation to building occupants, and to develop strategies for monitoring locations deemed Non-Applicable Water Sources to insure building occupants do not consume water from these locations.

Within the Manhasset Union Free School District, the following locations have been deemed Applicable Drinking Water Sources by the administration:

- 1) Water fountains and bottle filling stations;
- 2) Kitchen water faucets and pot fillers used in food preparation;
- 3) Ice machines
- 4) Elementary School classroom sinks

First draw samples were collected from each of these locations within the District, and analyzed by a New York State Department of Health ELAP certified laboratory. For results at or below 15 ppb, no further action is required until 2025. For locations above 15 ppb, options include: second and third draw sample collection to determine source of lead, designation of the location as Non-applicable Water Source, or permanent removal of the fixture from the location. In either case, the result was communicated by Enviroscience Consultants, and the fixture was shut off by the District immediately upon receipt of results.

The following locations within the Manhasset Union Free School District were deemed Non-Applicable Water Sources by the administration:

- 1) Science Laboratory sinks;
- 2) Art Room sinks;
- 3) Other classroom sinks;
- 4) Bathroom sinks;
- 5) Outside spigots
- 6) Custodial Closet sinks

In these cases, the District has placed signs adjacent to the fixture to notify occupants that the water is not intended for consumption. To further support this protocol, the following management of the locations is required:

- 1) Science Laboratory sinks - communicate in writing with students that these locations are for science experiments and hand washing only, not for consumption. This is most easily accomplished by including this language in the laboratory safety paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective science teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 2) Art Room sinks - communicate in writing to students that these locations are for cleaning of art supplies and hand washing only, not for consumption. This is most easily accomplished by including this language in the course paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective art teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 3) Other classroom sinks - classrooms in this category often include classrooms where students are to hand wash after bathroom usage or activities as part of a regular hygiene program. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 4) Bathroom sinks - in intermediate buildings, signage should be sufficient for communicating the concept of hand washing only. In elementary schools, personal hygiene should be integrated into curriculum to ensure students understand bathroom sinks are for hand washing only, and not consumption. Further, show what the signage looks like in bathrooms so they learn to recognize its meaning. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 5) Outside spigots - all-weather signage will be installed at each location. Further, spigots will have a special key maintained by the custodial staff to ensure that non-authorized persons do not fill sports coolers or use hoses for consumption. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 6) Custodial Closet sinks - these locations should be accessed by custodial personnel only, and locked when not in use. Access to others should be restricted. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.

II. Sampling Procedures:

In accordance with the regulation, EnviroScience Consultants, Inc. performed initial water sampling throughout the Manhasset Union Free School District on December 10, 2020. Samples were collected in wide-mouth 250 milliliter containers and were collected in the morning hours before the facilities opened. The water sources were not used for at least 8 hours and not more than 18 hours prior to sampling. Unique source numbers and designations were assigned to each source location. Unique sample identification numbers were assigned to each sample taken. The key to fixture type codes and the sampling location schematics are shown below.

Fixture Type Codes

BF Bottle Filler
 HB Hose Bib
 IM Ice Machine
 OS Other Source
 PF Pot Filler
 SK Sink
 SL Supply Line
 SP Spigot
 SPY Spray
 SS Slop Sink
 V Valve
 WC Water Cooler
 WF Water Fountain


Source Designations

App Applicable
 N/A Non-applicable

Remediation Type Codes

FR Fixture Replacement
 FRSLV Fixture, supply line or valve replacement
 FRSLVPA Fixture, supply line or valve replacement plumbing assessment
 SIGN Non-potable water sign posted
 CAPPED Supply line capped or fixture removed

Sampling Location Schematics

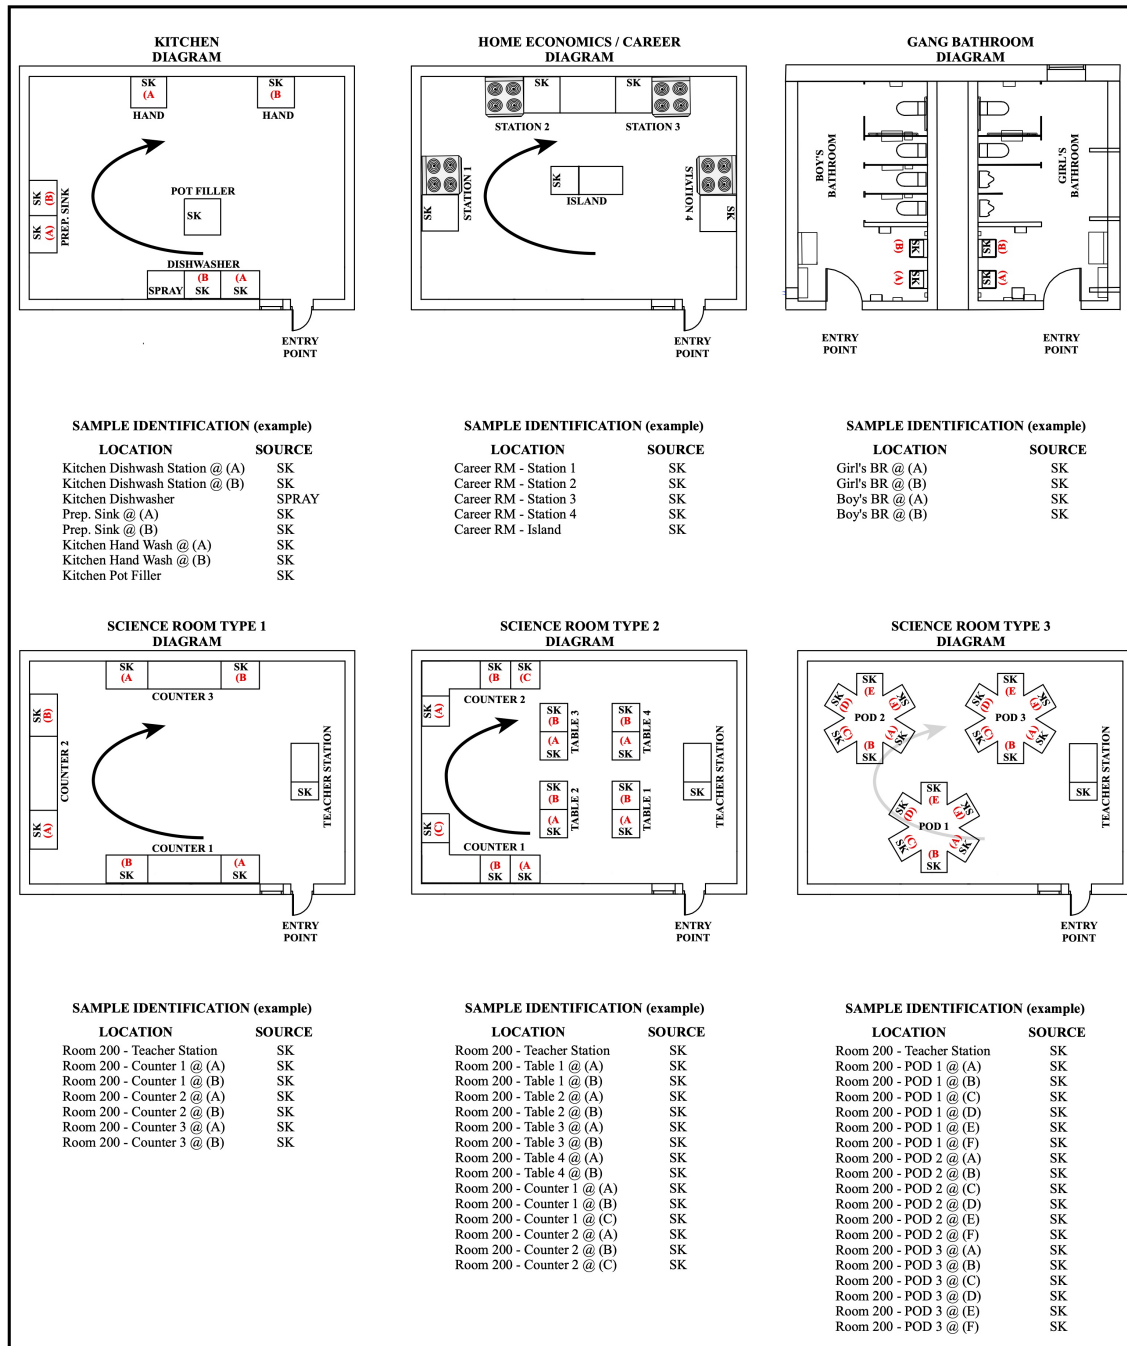

III. Initial Results:

All water source locations in each of the school buildings were assessed. Water source locations identified as drinking water sources were considered Applicable, and first draw samples were collected. Water source locations identified as non-drinking water sources were considered Non-applicable and these locations were documented.

The results of the initial sampling and the use of signs warning against water use at Non-applicable sources is documented in the School Water Outlet Inventory for each building (Appendix A through C).

All elevated locations should be taken off line until the remediation is completed. Any other drinking water sources in these buildings that were not functional at the time of initial sampling and have not been tested should be tested. All locations deemed non-applicable, but do not have signs, should be taken off line until signs have been posted.

The following is a summary of results in parts per billion (ppb) of locations where sample results were found above 15 ppb:

Manhasset Secondary School

No Exceedances

Munsey Park Elementary School

Room 121A	SK	17.1
Room 231@B	SK	52

Shelter Rock Elementary School

Room 041	SK	15.4
Room 046	SK	15.3
Room 047	SK	32.1
Room 048	SK	245
Room 049	SK	26.7
Room 053	SK	63.4
Room 054	SK	42.2

Appendix A

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Receiving Hallway Custodial Closet	SS	N/A		12/10/2020	-	-	-	None	Locked door	-	-
1001-2	Receiving Hallway Ladies Room	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1002-1	Kitchen Island	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1002-2	Kitchen 3-Bay @ A	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1002-3	Kitchen 3-Bay @ A	SPY	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1002-4	Kitchen 3-Bay @ B	SK	App	2.2	12/10/2020	-	-	-	None	-	-	-
1002-5	Kitchen 2-Bay	SPY	App	1.33	12/10/2020	-	-	-	None	-	-	-
1002-6	Kitchen Handwash	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1002-7	Kitchen Ice Machine	IM	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1002-8	Kitchen Deli	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1002-9	Kitchen Deli	SPY	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1002-10	Kitchen Deli Handwash	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1003-1	Room 127 Pod 1 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1003-2	Room 127 Pod 1 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1003-3	Room 127 Pod 2 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1003-4	Room 127 Pod 2 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1003-5	Room 127 Pod 3 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1003-6	Room 127 Pod 3 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1003-7	Room 127 Pod 4 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1003-8	Room 127 Pod 4 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1003-9	Room 127 Pod 5 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1003-10	Room 127 Pod 5 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1003-11	Room 127 Pod 6 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1003-12	Room 127 Pod 6 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1003-13	Room 127 Counter	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1046-1	Cafeteria	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1004-2	Hall by Room 120	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1004-3	Hall by Room 120	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1005-1	Boy's Bathroom by Room 129 @ A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1005-2	Boy's Bathroom by Room 129 @ B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1006-1	Room 120 Counter 1 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1006-2	Room 120 Counter 1 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1006-3	Room 120 Counter 1 @ C	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1006-4	Room 120 Teacher's Station	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1006-5	Room 120 Pod 1	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1006-6	Room 120 Pod 2 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1006-7	Room 120 Pod 2 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1006-8	Room 120 Pod 3 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1006-9	Room 120 Pod 3 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1006-10	Room 120 Pod 4 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1006-11	Room 120 Pod 4 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1006-12	Room 120 Pod 5 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1006-13	Room 120 Pod 5 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1006-14	Room 120 Pod 6 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1006-15	Room 120 Pod 6 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1006-16	Room 120 Pod 7 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1006-17	Room 120 Pod 7 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1006-18	Room 120 Pod 8 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1006-19	Room 120 Pod 8 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1006-20	Room 120A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1006-21	Room 120A	SS	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1007-1	Room 131 Teacher's Station	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1007-2	Room 131 Pod 1	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1007-3	Room 131 Pod 2 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1007-4	Room 131 Pod 2 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1007-5	Room 131 Pod 3 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1007-6	Room 131 Pod 3 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1007-7	Room 131 Pod 4 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1007-8	Room 131 Pod 4 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1007-9	Room 131 Pod 5 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1007-10	Room 131 Pod 5 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1007-11	Room 131 Pod 6 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1007-12	Room 131 Pod 6 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1007-13	Room 131 Pod 7 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1007-14	Room 131 Pod 7 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1007-15	Room 131 Pod 8 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1007-16	Room 131 Pod 8 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1007-17	Room 131 Counter 1 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1007-18	Room 131 Counter 1 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1008-1	Room 122 Teachers' Station	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1008-2	Room 122 Pod 1	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1008-3	Room 122 Pod 2	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1008-4	Room 122 Pod 3	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1008-5	Room 122 Pod 4	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1008-6	Room 122 Pod 5	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1008-7	Room 122 Pod 6	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1008-8	Room 122 Pod 7	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1008-9	Room 122 Counter 1	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1008-10	Room 122 Counter 2	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1009-1	Girl's Locker Room Bathroom @ A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1009-2	Girl's Locker Room Bathroom @ B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1009-3	Girl's Locker Room Bathroom @ C	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1009-4	Girl's Locker Room Coach's Office Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1010-1	Gym (east)	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1010-2	Gym (east)	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1011-1	Health Office Bathroom	SK	App	3.82	12/10/2020	-	-	-	None	-	-	-
1012-1	Hall by Health Office	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1012-2	Hall by Health Office	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1013-1	Boy's Bathroom by Health Office @A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1013-2	Boy's Bathroom by Health Office @B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1014-1	Boy's Locker Room Bathroom @ A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1014-2	Boy's Locker Room Bathroom @ B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1014-3	Boy's Locker Room Coach's Office	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1015-1	Gym (west)	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1015-2	Gym (west)	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1016-1	Middle School Boy's Locker Room @A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1016-2	Middle School Boy's Locker Room @B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1016-3	Middle School Boy's Locker Room @C	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1016-4	Middle School Boy's Locker Room Coach's Office	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1017-1	Middle School Girl's Locker Room @A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1017-2	Middle School Girl's Locker Room @B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1017-3	Middle School Girl's Locker Room @C	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1017-4	Middle School Girl's Locker Room Coach's Office	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1018-1	Room 141 Teacher's Station	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1018-2	Room 141 Counter 1	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1018-3	Room 141 Counter 2	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1018-4	Room 141 Pod 1 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1018-5	Room 141 Pod 1 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1018-6	Room 141 Pod 2 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1018-7	Room 141 Pod 2 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1018-8	Room 141 Pod 3 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1018-9	Room 141 Pod 3 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1018-10	Room 141 Pod 4 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1018-11	Room 141 Pod 4 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1018-12	Room 141 Pod 5 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1018-13	Room 141 Pod 5 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1018-14	Room 141 Pod 6 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1018-15	Room 141 Pod 6 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1018-16	Room 141 Pod 7 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1018-17	Room 141 Pod 7 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1018-18	Room 141 Rear Teacher's Station	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1019-1	Hall by Room 140	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1019-2	Hall by Room 140	BF	App	<1.0	1/22/2021	-	-	-	None		-	-
1020-1	Room 140 Pod 1 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1020-2	Room 140 Pod 1 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1020-3	Room 140 Pod 2 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1020-4	Room 140 Pod 2 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1020-5	Room 140 Pod 3 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1020-6	Room 140 Pod 3 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1020-7	Room 140 Pod 4 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1020-8	Room 140 Pod 4 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1020-9	Room 140 Pod 5 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1020-10	Room 140 Pod 5 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1020-11	Room 140 Pod 6 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1020-12	Room 140 Pod 6 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1020-13	Room 140 Pod 7 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1020-14	Room 140 Pod 7 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1021-1	Science Coffee Room	SL	App	<1.0	9/2/2020	-	-	-	None	-	-	-
1022-1	Custodial Closet S-133	SS	N/A		12/10/2020	-	-	-	None	Locked door	-	-
1023-1	Room 145 Fume Hood @A	SP	N/A		12/10/2020	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1023-2	Room 145 Fume Hood @B	SP	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1023-3	Room 145 Fume Hood @C	SP	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1023-4	Room 145 Counter 1	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1023-5	Room 145 Pod 1 (left)	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1023-6	Room 145 Pod 2 (right)	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1024-1	Hall by Room 145	WF	App		12/10/2020	-	-	-	Sign Required	Removed From Service	-	-
1024-2	Hall by Room 145	BF	App	<1.0	1/22/2021	-	-	-	None	-	-	-
1025-1	Room 142 Teacher's Station	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1025-2	Room 142 Counter	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1025-3	Room 142 Pod 1 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1025-4	Room 142 Pod 1 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1025-5	Room 142 Pod 2 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1025-6	Room 142 Pod 2 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1025-7	Room 142 Pod 3 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1025-8	Room 142 Pod 3 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1025-9	Room 142 Pod 4 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1025-10	Room 142 Pod 4 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1025-11	Room 142 Pod 5 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1025-12	Room 142 Pod 5 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1025-13	Room 142 Pod 6 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1025-14	Room 142 Pod 6 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1025-15	Room 142 Pod 7 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1025-16	Room 142 Pod 7 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1026-1	Room 149 Teacher's Station	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1026-2	Room 149 Pod 1 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1026-3	Room 149 Pod 1 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1026-4	Room 149 Pod 2 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1026-5	Room 149 Pod 2 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1026-6	Room 149 Pod 3 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1026-7	Room 149 Pod 3 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1026-8	Room 149 Pod 4 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1026-9	Room 149 Pod 4 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1026-10	Room 149 Pod 5 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1026-11	Room 149 Pod 5 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1026-12	Room 149 Pod 6 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1026-13	Room 149 Pod 6 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1026-14	Room 149 Island Pod @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1026-15	Room 149 Island Pod @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1026-16	Room 149 Office/Prep Room	SK	App	2.37	12/10/2020	-	-	-	None	-	-	-
1027-1	Men's Faculty Bathroom by Room 154 @ A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1027-2	Men's Faculty Bathroom by Room 154 @ B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1027-3	Men's Faculty Bathroom by Room 154 @ C	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1028-1	Hall by Room 154	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1028-2	Hall by Room 154	BF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1029-1	Room 154	SK	App	2.71	12/10/2020	-	-	-	None	-	-	-
1030-1	Custodial Closet S-138	SS	N/A		12/10/2020	-	-	-	None	Locked door	-	-
1031-1	Women's Faculty Bathroom by Room 154 @ A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1031-2	Women's Faculty Bathroom by Room 154 @ B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1031-3	Women's Faculty Bathroom by Room 154 @ C	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1032-1	Room 156 Teacher's Station	SK	N/A		12/10/2020	-	-	-	None	SIGN	-	-
1032-2	Room 156 Counter	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1033-1	Hall by Room 170	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1033-2	Hall by Room 170	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1034-1	Girl's Bathroom by Room 170 @ A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1034-2	Girl's Bathroom by Room 170 @ B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1034-3	Girl's Bathroom by Room 170 @ C	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1034-4	Girl's Bathroom by Room 170 @ D	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1035-1	Room 152A (168)	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1036-1	Hall by Room 176	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1036-2	Hall by Room 176	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1037-1	Custodial Closet by Elevator	SS	N/A		12/10/2020	-	-	-	None	Locked door	-	-
1038-1	Custodial Closet by Room 110	SS	N/A		12/10/2020	-	-	-	None	Locked door	-	-
1039-1	Boy's Bathroom by Room 110 @ A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1039-2	Boy's Bathroom by Room 110 @ B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1040-1	Hall by Room 108	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1040-2	Hall by Room 108	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1041-1	Room 108 Home Economics Station 1	SK	App	4.09	12/10/2020	-	-	-	None	-	-	-
1041-2	Room 108 Home Economics Station 2	SK	App	1.99	12/10/2020	-	-	-	None	-	-	-
1041-3	Room 108 Home Economics Station 3	SK	App	1.09	12/10/2020	-	-	-	None	-	-	-
1041-4	Room 108 Home Economics Station 4	SK	App	8.16	12/10/2020	-	-	-	None	-	-	-
1042-1	Girl's Bathroom by Room 104 @ A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1042-2	Girl's Bathroom by Room 104 @ B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1043-1	Life Skills Room	SK	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1044-1	High School Media Center Office	SK	App	6.53	12/10/2020	-	-	-	None	-	-	-
1045-1	Hall by Service Area	WF	App		1/22/2021					Removed From Service		
1045-2	Hall by Service Area	BF	App	<1.0	1/22/2021							
2001-1	Hall by Middle School Media Center	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
2001-2	Hall by Middle School Media Center	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
2002-1	Unisex Bathroom by MS Media Center @ A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2002-2	Unisex Bathroom by MS Media Center @ B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2003-1	Faculty Bathroom by MS Media Center @ A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2003-2	Faculty Bathroom by MS Media Center @ B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2004-1	Middle School Media Center Office	SK	App	6.65	12/10/2020	-	-	-	None	-	-	-
2005-1	Hall by Main Office	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
2005-2	Hall by Main Office	BF	App	<1.0	1/22/2021	-	-	-	None		-	-
2006-1	Custodial Closet by Main Office	SS	N/A		12/10/2020	-	-	-	None	Locked door	-	-
2007-1	Boy's Bathroom by Main Office @ A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2007-2	Boy's Bathroom by Main Office @ B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2008-1	Girl's Bathroom by Room 207 @ A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2008-1	Girl's Bathroom by Room 207 @ B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2009-1	Counseling Center Faculty Bathroom-left	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2009-2	Counseling Center Faculty Bathroom-right	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2010-1	Room 225 Bathroom-left	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2010-2	Room 225 Bathroom-right	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2011-1	Faculty Lounge Coffee Maker	SL	App	<1.0	9/2/2020	-	-	-	None	-	-	-
2012-1	Girl's Bathroom by Room 233 @ A	SK	App		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2012-2	Girl's Bathroom by Room 233 @ B	SK	App		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2013-1	Custodial Closet by Room 233	SS	N/A		12/10/2020	-	-	-	None	Locked door	-	-
2014-1	Band Locker Room	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
2015-1	Faculty Bathroom by Room 240 @ A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2015-2	Faculty Bathroom by Room 240 @ B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2016-1	Custodial Closet S-218	SS	N/A		12/10/2020	-	-	-	None	Locked door	-	-
2017-1	Hall by Room 240	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
2017-2	Hall by Room 240	BF	App	<1.0	1/22/2021	-	-	-	None		-	-
2018-1	Room 245 Teacher's Station	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2018-2	Room 245 Counter 1 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2018-3	Room 245 Counter 1 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2018-4	Room 245 Counter 2	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2018-5	Room 245 Pod 1 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2018-6	Room 245 Pod 1 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2018-7	Room 245 Pod 2 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2018-8	Room 245 Pod 2 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2018-9	Room 245 Pod 3 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2018-10	Room 245 Pod 3 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2018-11	Room 245 Pod 4 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2018-12	Room 245 Pod 4 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2018-13	Room 245 Pod 5 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2018-14	Room 245 Pod 5 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2018-15	Room 245 Pod 6 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2018-16	Room 245 Pod 6 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2018-17	Room 245 Pod 7 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2018-18	Room 245 Pod 7 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2019-1	Room Teacher's Station	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2019-2	Room 247 Counter 1 @A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2019-3	Room 247 Counter 1 @B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2019-4	Room 247 Counter 2	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2019-5	Room 247 Pod 1	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2020-1	Room 247/249 Science Prep	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2021-1	Room 249 Counter 1	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2021-2	Room 249 Counter 2 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2021-3	Room 249 Counter 2 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2021-4	Room 249 Island	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2022-1	Room 251 Teacher's Station	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2023-1	Boy's Bathroom by Room 256 @ A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2023-2	Boy's Bathroom by Room 256 @ B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2023-3	Boy's Bathroom by Room 256 @ C	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2024-1	Hall by Room 256	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
2024-2	Hall by Room 256	BF	App	<1.0	1/22/2021	-	-	-	None		-	-
2025-1	Girl's Bathroom by Room 256 @ A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2025-2	Girl's Bathroom by Room 256 @ B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2025-3	Girl's Bathroom by Room 256 @ C	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2026-1	Custodial Closet by Room 256	SS	N/A		12/10/2020	-	-	-	None	Locked door	-	-
2027-1	Hall by Middle School Main Office	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
2027-2	Hall by Middle School Main Office	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
2028-1	Boy's Bathroom by MS Main Office @ A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2028-1	Boy's Bathroom by MS Main Office @ B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2028-1	Boy's Bathroom by MS Main Office @ C	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2028-1	Boy's Bathroom by MS Main Office @ D	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2029-1	Custodial Closet by MS Main Office	SS	N/A		12/10/2020	-	-	-	None	Locked door	-	-
2030-1	Hall by Room 278	WF	App	<1.0	9/2/2020	-	-	-	None	-	-	-
2030-2	Hall by Room 278	BF	App	<1.0	9/2/2020	-	-	-	None	-	-	-
2031-1	Room 278	SS	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
3001-1	Custodial Closet by Room 309	SS	N/A		12/10/2020	-	-	-	None	Locked door	-	-
3002-1	Men's Bathroom by Room 309 @ A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
3002-2	Men's Bathroom by Room 309 @ B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
3003-1	Room 308 - Art Lower Counter	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
3003-2	Room 308 - Art Unit 1 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
3003-3	Room 308 - Art Unit 1 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
3003-4	Room 308 - Art Unit 2 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
3003-5	Room 308 - Art Unit 2 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
3003-6	Room 308 - Art Unit 3 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
3003-7	Room 308 - Art Unit 3 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
3004-1	Hall by Room 308	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
3004-2	Hall by Room 308	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
3005-1	Faculty Bathroom by Room 308 @ A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
3005-2	Faculty Bathroom by Room 308 @ B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
3006-1	Room 302 - Art Unit 1 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
3006-2	Room 302 - Art Unit 1 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
3006-3	Room 302 - Art Unit 2 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
3006-4	Room 302 - Art Unit 2 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
3006-5	Room 302 - Art Unit 3 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
3006-6	Room 302 - Art Unit 3 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
3006-7	Room 302 - Art Lower Counter	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
3007-1	Room 301 - Art Lower Counter	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
3007-2	Room 301 - Art Unit 1 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
3007-3	Room 301 - Art Unit 1 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
3007-4	Room 301 - Art Unit 2 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
3007-5	Room 301 - Art Unit 2 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
3007-6	Room 301 - Art Unit 3 @ A	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
3007-7	Room 301 - Art Unit 3 @ B	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
4001-1	Room 410	SS	N/A		12/10/2020	-	-	-	Sign Required	-	-	

Laboratory Report

NYE Report #: 2205001-16457

December 15, 2020

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Manhasset Secondary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on December 14, 2020. New York Environmental analyzed the samples on December 14, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	10 Dec 2020
Date Received:	14 Dec 2020
Date Analyzed:	14 Dec 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201214I061	1	Kitchen Island-SK; Initial	1.00	<1.00	µg/L	
201214I062	2	Kitchen 3-Bay @ A-SK; Initial	1.00	<1.00	µg/L	
201214I063	3	Kitchen 3-Bay @ A-SPY; Initial	1.00	<1.00	µg/L	
201214I064	4	Kitchen 3-Bay @ B-SK; Initial	1.00	2.20	µg/L	
201214I065	5	Kitchen 2-Bay-SPY; Initial	1.00	1.33	µg/L	
201214I066	6	Kitchen Ice Machine-IM; Initial	1.00	<1.00	µg/L	
201214I067	7	Kitchen Deli-SK; Initial	1.00	<1.00	µg/L	
201214I068	8	Kitchen Deli-SPY; Initial	1.00	<1.00	µg/L	
201214I069	9	Hall by Room 120-BF; Initial	1.00	<1.00	µg/L	
201214I070	10	Gym (east)-BF; Initial	1.00	<1.00	µg/L	
201214I071	11	Health Office Bathroom-SK; Initial	1.00	3.82	µg/L	
201214I072	12	Hall by Health Office-BF; Initial	1.00	<1.00	µg/L	
201214I073	13	Gym (west)-BF; Initial	1.00	<1.00	µg/L	
201214I074	14	Room 149 Office/Prep Room-SK; Initial	1.00	2.37	µg/L	
201214I075	15	Room 154-SK; Initial	1.00	2.71	µg/L	
201214I076	16	Hall by Room 170-WF; Initial	1.00	<1.00	µg/L	
201214I077	17	Hall by Room 176-BF; Initial	1.00	<1.00	µg/L	
201214I078	18	Hall by Room 108-BF; Initial	1.00	<1.00	µg/L	
201214I079	19	Room 108 Home Economics Station 1-SK; Initial	1.00	4.09	µg/L	
201214I080	20	Room 108 Home Economics Station 2-SK; Initial	1.00	1.99	µg/L	
201214I081	21	Room 108 Home Economics Station 3-SK; Initial	1.00	1.09	µg/L	
201214I082	22	Room 108 Home Economics Station 4-SK; Initial	1.00	8.16	µg/L	
201214I083	23	High School Media Center Office-SK; Initial	1.00	6.53	µg/L	
201214I084	24	Hall by Middle School Media Center-BF; Initial	1.00	<1.00	µg/L	
201214I085	25	Middle School Media Center Office-SK; Initial	1.00	6.65	µg/L	
201214I086	26	Band Locker Room-SK; Initial	1.00	<1.00	µg/L	



Date Collected:	10 Dec 2020
Date Received:	14 Dec 2020
Date Analyzed:	14 Dec 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

<u>Lab ID</u>	<u>CID</u>	<u>Sample Location/Description</u>	<u>LOQ</u>	<u>Result</u>	<u>Units</u>	<u>Flag</u>
201214I087	27	Hall by Middle School Main Office-BF; Initial	1.00	<1.00	µg/L	
201214I088	28	Hall by Room 308-BF; Initial	1.00	<1.00	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Laboratory Report

NYE Report #: 2210311-16761

January 25, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Manhasset Secondary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on January 22, 2021. New York Environmental analyzed the samples on January 25, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	22 Jan 2021
Date Received:	22 Jan 2021
Date Analyzed:	25 Jan 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210122I001	1	Hall by Room 256; Initial	1.00	<1.00	µg/L	
210122I002	2	Hall by Room 240; Initial	1.00	<1.00	µg/L	
210122I003	3	Hall by Main Office; Initial	1.00	<1.00	µg/L	
210122I004	4	Hall by Service Area; Initial	1.00	<1.00	µg/L	
210122I005	5	Hall by Room 145; Initial	1.00	<1.00	µg/L	
210122I006	6	Hall by Room 140; Initial	1.00	<1.00	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Appendix B

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0001-1	Hallway by Elevator	WF	App		12/10/2020	-	-	-	None	-	-	-
0001-2	Hallway by Elevator	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
0002-1	Room K01	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
0002-2	Room K01 Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
0003-1	Room K02	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
0003-2	Room K02 Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
0004-1	Room K03	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
0004-2	Room K03 Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
0005-1	Room K04	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
0005-2	Room K04 Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
0006-1	Boy's Bathroom in Kindergarten Wing - Left	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
0006-2	Boy's Bathroom in Kindergarten Wing - Right	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
0007-1	Faculty ADA Bathroom in Kindergarten Wing	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
0008-1	Girl's Bathroom in Kindergarten Wing - Left	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
0008-2	Girl's Bathroom in Kindergarten Wing - Right	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
0009-1	Boiler Room	SS	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1001-1	Kitchen Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1001-2	Kitchen Handwash	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1001-3	Kitchen Dishwash 3-Bay - Left	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1001-4	Kitchen Dishwash 3-Bay - Right	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-5	Kitchen Dishwash 3-Bay	SPY	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1001-6	Kitchen Dishwash Handwash	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1001-7	Kitchen 2-Bay (In Corner)	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1001-8	Kitchen Prep Island	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1001-9	Kitchen Handwash by Island	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1002-1	Cafeteria	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1002-2	Cafeteria	WF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1002-3	Cafeteria	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1003-1	Custodial Closet by Main Lobby	SS	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1004-1	Boy's Bathroom by Main Lobby - Left	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1004-2	Boy's Bathroom by Main Lobby - Right	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1005-1	Room 129	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1006-1	Hallway by Room 129	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1006-2	Hallway by Room 129	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1007-1	Nurse's Office Room 119	SK	App	2.55	12/10/2020	-	-	-	None	-	-	-
1008-1	Room 128	SK	App	3.83	12/10/2020	-	-	-	None	-	-	-
1009-1	Girl's Bathroom by Room 120 - Left	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1009-2	Girl's Bathroom by Room 120 - Right	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1010-1	Faculty Bathroom by Room 128A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1011-1	Men's Faculty Bathroom by Room 121	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1012-1	Room 121A	SK	App	35.7	12/24/2020	1.01	1.11		FR	Fixture Replacement	1.12	1/22/2021
1013-1	Hallway by Room 121	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1013-2	Hallway by Room 121	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1014-1	Main Office Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1014-2	Principal's Office Bathroom by Safe	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1015-1	Old Nurse's Office Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1015-2	Old Nurse's Office Exam Room	SK	App	1.73	12/10/2020	-	-	-	None	-	-	-
1016-1	Room 130	SK	App	3.25	12/10/2020	-	-	-	None	-	-	-
1017-1	Room 135	SK	App	1.05	12/10/2020	-	-	-	None	-	-	-
1018-1	Custodial Closet by Room 135	SS	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1019-1	Hallway by Room 135	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1019-2	Hallway by Room 135	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1020-1	Boy's Locker Room	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1020-2	Boy's Locker Room Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1020-3	Boy's Locker Room Coach's Office Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1021-1	Girl's Locker Room Coach's Office Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1021-2	Girl's Locker Room	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1021-3	Girl's Locker Room Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1022-1	Auditorium Lobby	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1022-2	Auditorium Lobby	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1023-1	Girl's Bathroom by Auditorium - Left	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1023-2	Girl's Bathroom by Auditorium - Right	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1024-1	Custodial Closet by Auditorium	SS	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1025-1	Boy's Bathroom by Auditorium - Left	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1025-2	Boy's Bathroom by Auditorium - Right	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1026-1	Room 133	SK	App	2.7	12/10/2020	-	-	-	None	-	-	-
1027-1	Hallway by Room 133	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1027-2	Hallway by Room 133	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1028-1	Room 132	SK	App	1.47	12/10/2020	-	-	-	None	-	-	-
1029-1	Library Kitchenette	SK	App	2.14	12/10/2020	-	-	-	None	-	-	-
1030-1	Hallway by Room 108	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1030-2	Hallway by Room 108	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1031-1	Custodial Closet by Room 110	SS	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1032-1	Boy's Bathroom by Room 110 - Left	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1032-2	Boy's Bathroom by Room 110 - Middle	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1032-3	Boy's Bathroom by Room 110 - Right	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1033-1	Room 111	SK	App	1.36	12/10/2020	-	-	-	None	-	-	-
1034-1	Room 114	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1034-2	Room 114	SPY	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1035-1	Girl's Bathroom by Room 113 - Left	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1035-2	Girl's Bathroom by Room 113 - Right	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1036-1	Hallway by Room 113	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1036-2	Hallway by Room 113	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1037-1	Custodial Closet in New Wing	SS	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1038-1	Girl's Bathroom in New Wing - Left	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1038-2	Girl's Bathroom in New Wing - Right	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1039-1	Faculty Bathroom in New Wing	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1040-1	Boy's Bathroom in New Wing - Left	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1040-2	Boy's Bathroom in New Wing - Right	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1041-1	Room 104	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1042-1	Room 103	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1043-1	Hallway in New Wing	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1043-2	Hallway in New Wing	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1044-1	Room 102	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1045-1	Room 105	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1046-1	Room 101	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1047-1	Room 106	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2001-1	Girl's Bathroom by Room 203 - Left	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2001-2	Girl's Bathroom by Room 203 - Right	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2002-1	Custodial Closet by Room 203	SS	N/A		12/10/2020	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2003-1	Hallway by Room 203	WF	App	<1.0	9/2/2020	-	-	-	None		-	-
2003-2	Hallway by Room 203	BF	App	<1.0	9/2/2020	-	-	-	None	-	-	-
2004-1	Room 206	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2005-1	Room 201	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2006-1	Room 202	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2007-1	Room 203	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2008-1	Room 204	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2009-1	Room 205	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2010-1	Boy's Bathroom by Room 204 - Left	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2010-2	Boy's Bathroom by Room 204 - Right	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2011-1	Faculty ADA Bathroom by Room 204	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2012-1	Hallway by Room 209	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
2012-2	Hallway by Room 209	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
2013-1	Custodial Closet by Room 210	SS	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2014-1	Boy's Bathroom by Room 210 - Left	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2014-2	Boy's Bathroom by Room 210 - Right	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2015-1	Room 211	SK	App	5.41	12/10/2020	-	-	-	None	-	-	-
2016-1	Girl's Bathroom by Room 213 - Left	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2016-2	Girl's Bathroom by Room 213 - Right	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2017-1	Room 216	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2018-1	Room 217	SK	App	2.31	12/10/2020	-	-	-	None	-	-	-
2019-1	Room 231 @A	SK	App	3.85	12/10/2020	-	-	-	None	-	-	-
2019-2	Room 231 @B	SK	App	52	12/10/2020				Additional Sampling Required	Aerator Cleaned	10.2	12/24/2020
2019-3	Room 231 @C	SK	App	3.45	12/10/2020	-	-	-	None	-	-	-
2020-1	Custodial Closet by Room 229	SS	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
2021-1	Boy's Bathroom by Room 229 - Left	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2021-2	Boy's Bathroom by Room 229 - Right	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2022-1	Hallway by Room 218	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
2022-2	Hallway by Room 218	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
2023-1	Room 228	SK	App	1.38	12/10/2020	-	-	-	None	-	-	-
2024-1	Girl's Bathroom by Room 220 - Left	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2024-2	Girl's Bathroom by Room 220 - Right	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2025-1	Faculty Lounge	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2025-1	Faculty Lounge Coffee Maker	SL	N/A		12/10/2020	-	-	-		-	-	-
2025-2	Faculty Lounge Bathroom	SK	N/A	<1.0	3/3/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2026-1	Hallway by Room 223	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
2026-2	Hallway by Room 223	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
2027-1	Room 224	SK	App	1.35	12/10/2020	-	-	-	None	-	-	-
2028-1	Room 225 @A	SK	App	6	12/10/2020	-	-	-	None	-	-	-
2028-2	Room 225 @B	SK	App	2.37	12/10/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2028-3	Room 225 @C	SK	App	2.71	12/10/2020	-	-	-	None	-	-	-

Laboratory Report

NYE Report #: 2205003-16459

December 15, 2020

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Munsey Park Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on December 14, 2020. New York Environmental analyzed the samples on December 14, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	10 Dec 2020
Date Received:	14 Dec 2020
Date Analyzed:	14 Dec 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201214I118	1	Kitchen Dishwash 3-Bay - Left-SK; Initial	1.00	<1.00	µg/L	
201214I119	2	Kitchen Dishwash 3-Bay - Right-SK; Initial	1.00	<1.00	µg/L	
201214I120	3	Kitchen Dishwash 3-Bay-SPY; Initial	1.00	<1.00	µg/L	
201214I121	4	Kitchen 2-Bay (In Corner)-SK; Initial	1.00	<1.00	µg/L	
201214I122	5	Kitchen Prep Island-SK; Initial	1.00	<1.00	µg/L	
201214I123	6	Cafeteria-WF; Initial	1.00	<1.00	µg/L	
201214I124	7	Cafeteria-BF; Initial	1.00	<1.00	µg/L	
201214I125	8	Room 129-SK; Initial	1.00	<1.00	µg/L	
201214I126	9	Hallway by Room 129-BF; Initial	1.00	<1.00	µg/L	
201214I127	10	Nurse's Office Room 119-SK; Initial	1.00	2.55	µg/L	
201214I128	11	Room 128-SK; Initial	1.00	3.83	µg/L	
201214I129	12	Room 121A-SK; Initial	1.00	17.1	µg/L	H
201214I130	13	Hallway by Room 121-BF; Initial	1.00	<1.00	µg/L	
201214I131	14	Old Nurse's Office Exam Room-SK; Initial	1.00	1.73	µg/L	
201214I132	15	Room 130-SK; Initial	1.00	3.25	µg/L	
201214I133	16	Room 135-SK; Initial	1.00	1.05	µg/L	
201214I134	17	Hallway by Room 135-BF; Initial	1.00	<1.00	µg/L	
201214I135	18	Auditorium Lobby-WF; Initial	1.00	<1.00	µg/L	
201214I136	19	Room 133-SK; Initial	1.00	2.70	µg/L	
201214I137	20	Hallway by Room 133-BF; Initial	1.00	<1.00	µg/L	
201214I138	21	Room 132-SK; Initial	1.00	1.47	µg/L	
201214I139	22	Library Kitchenette-SK; Initial	1.00	2.14	µg/L	
201214I140	23	Hallway by Room 108-BF; Initial	1.00	<1.00	µg/L	
201214I141	24	Room 111-SK; Initial	1.00	1.36	µg/L	
201214I142	25	Room 114-SK; Initial	1.00	<1.00	µg/L	
201214I143	26	Room 114-SPY; Initial	1.00	<1.00	µg/L	

Date Collected:	10 Dec 2020
Date Received:	14 Dec 2020
Date Analyzed:	14 Dec 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201214I144	27	Hallway by Room 113-BF; Initial	1.00	<1.00	µg/L	
201214I145	28	Hallway in New Wing-BF; Initial	1.00	<1.00	µg/L	
201214I146	29	Hallway by Elevator-BF; Initial	1.00	<1.00	µg/L	
201214I147	31	Hallway by Room 209-BF; Initial	1.00	<1.00	µg/L	
201214I148	32	Room 211-SK; Initial	1.00	5.41	µg/L	
201214I149	33	Room 216-SK; Initial	1.00	<1.00	µg/L	
201214I150	34	Room 217-SK; Initial	1.00	2.31	µg/L	
201214I151	35	Room 231 @A-SK; Initial	1.00	3.85	µg/L	
201214I152	36	Room 231 @B-SK; Initial	1.00	52.0	µg/L	E,H
201214I153	37	Room 231 @C-SK; Initial	1.00	3.45	µg/L	
201214I154	38	Hallway by Room 218-BF; Initial	1.00	<1.00	µg/L	
201214I155	39	Room 228-SK; Initial	1.00	1.38	µg/L	
201214I156	40	Hallway by Room 223-BF; Initial	1.00	<1.00	µg/L	
201214I157	41	Room 224-SK; Initial	1.00	1.35	µg/L	
201214I058	42	Room 225 @A-SK; Initial	1.00	6.00	µg/L	
201214I05A	43	Room 225 @B-SK; Initial	1.00	2.37	µg/L	
201214I05B	44	Room 225 @C-SK; Initial	1.00	2.71	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

Laboratory Report

NYE Report #: 2205136-16550

December 29, 2020

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Munsey Park Elementary, Manhasset, NY

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on December 24, 2020. New York Environmental analyzed the samples on December 28, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	24 Dec 2020
Date Received:	24 Dec 2020
Date Analyzed:	28 Dec 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201224J006	1	Room 0121A-SK; Initial	1.00	35.7	µg/L	H
201224J007	2	Room 231 @ B-SK; Initial	1.00	10.2	µg/L	
2012281015	1A	Room 0121A-SK; Follow-up (1)	1.00	1.01	µg/L	
2012281016	1B	Room 0121A-SK; Follow-up (2)	1.00	1.11	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.



Laboratory Report

NYE Report #: 2210313-16763

January 25, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Munsey Park Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on January 22, 2021. New York Environmental analyzed the samples on January 23, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	22 Jan 2021
Date Received:	22 Jan 2021
Date Analyzed:	23 Jan 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

<u>Lab ID</u>	<u>CID</u>	<u>Sample Location/Description</u>	<u>LOQ</u>	<u>Result</u>	<u>Units</u>	<u>Flag</u>
210122I010	1	Room 121A-SK; Initial	1.00	1.12	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

Appendix C

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen Handwash Station	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1001-2	Kitchen Dishwash Station @A	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1001-3	Kitchen Dishwash Station @B	SPY	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1001-4	Kitchen Food Prep Station @A	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1001-5	Kitchen Food Prep Station @B	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1001-6	Kitchen Pot Filler	PF	App	2.47	12/10/2020	-	-	-	None	-	-	-
1002-1	Loading Dock	SS	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1002-2	Loading Dock Women's Bathroom	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1003-1	Custodial Office Bathroom	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1004-1	Boys Bathroom @A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1004-2	Boys Bathroom @B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1004-3	Boys Bathroom Slop Sink	SS	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1005-1	Hallway by Cafeteria	WF	App	<1.0	9/2/2020	-	-	-	None	Removed From Service	-	-
1005-2	Hallway by Cafeteria	BF	App	<1.0	9/2/2020	-	-	-	None		-	-
1006-1	Girls Bathroom @A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1006-2	Girls Bathroom @B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1007-1	Music Room 33	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1008-1	Room 33	SK	App	1.21	12/10/2020	-	-	-	None	-	-	-
1008-2	Room 33	SPY	N/A		12/10/2020	-	-	-	None	Removed From Service	-	-
1009-1	Special Ed Office 32	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1009-2	Special Ed Office 32 Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1010-1	Hallway by Special Ed Office 32	WF	App		12/10/2020				None	Removed From Service		
1010-2	Hallway by Special Ed Office 32	BF	App	<1.0	12/10/2020				None			
1011-1	Custodial Slop Sink	SS	N/A		12/10/2020	-	-	-	None	Locked Door	-	-
1012-1	Handicapped Girls Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1013-1	Handicapped Boys Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1014-1	Women's Bathroom near Stair 5	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1015-1	Men's Bathroom near Stair 5	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1016-1	Teachers Lounge	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1016-1	Teachers Lounge Coffee Maker	SL	App	<1.0	3/3/2020	-	-	-	None	-	-	-
1017-1	Principals Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1018-1	Womens Bathroom near Computer Room	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1019-1	Science Room Kitchenette	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1019-2	Science Room @A	SK	N/A		12/10/2020	-	-	-	None	Removed From Service	-	-
1019-3	Science Room @B	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1020-1	Nurses Office	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1020-2	Nurses Office Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1021-1	Custodial Slop Sink	SS	N/A		12/10/2020	-	-	-	None	Locked Door	-	-
1022-1	Girls Bathroom @ Primary Gym	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1023-1	Primary Gym	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1024-1	Hallway by Room 01A	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1024-2	Hallway by Room 01A	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1025-1	Boys Bathroom by Room 01A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1026-1	Room 001	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1026-2	Room 001	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1026-3	Room 001 Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1027-1	Room 002	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1027-2	Room 002	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1027-3	Room 002 Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1028-1	Room 003 Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1029-1	Room 004	SK	App	1.04	12/10/2020	-	-	-	None	-	-	-
1029-2	Room 004	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1029-3	Room 004 Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1030-1	Room 005	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1030-2	Room 005	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1030-3	Room 005 Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1031-1	Room 006	SK	App	1.72	12/10/2020	-	-	-	None	-	-	-
1031-2	Room 006	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1031-3	Room 006 Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1032-1	Room 007	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1032-2	Room 007	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1032-3	Room 007 Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1033-1	Room 008	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1033-2	Room 008	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1033-3	Room 008 Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1034-1	Room 09	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1034-2	Room 09	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1035-1	Room 10	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1035-2	Room 10	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1036-1	Room 11	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1036-2	Room 11	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1037-1	Room 12	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1037-2	Room 12	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1038-1	Room 13	SK	App	1.07	12/10/2020	-	-	-	None	-	-	-
1038-2	Room 13	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1039-1	Room 14	SK	App	1.67	12/10/2020	-	-	-	None	-	-	-
1039-2	Room 14	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1040-1	Room 15	SK	App	3.64	12/10/2020	-	-	-	None	-	-	-
1040-2	Room 15	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1041-1	Room 16	SK	App	1.32	12/10/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1042-1	Boys Bathroom by Storage 2 @A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1042-2	Boys Bathroom by Storage 2 @B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1042-3	Boys Bathroom by Storage 2 @C	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1043-1	Custodial Slop Sink by Storage 2	SS	N/A		12/10/2020	-	-	-	None	Locked Door	-	-
1044-1	Girls Bathroom by Storage 2 @A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1044-2	Girls Bathroom by Storage 2 @B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1044-3	Girls Bathroom by Storage 2 @C	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1045-1	Women's Bathroom by Storage 2	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1046-1	Room 21	SK	App	1.14	12/10/2020	-	-	-	None	-	-	-
1046-2	Room 21 Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1046-3	Room 21 Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1047-1	Library	SK	App	2.63	12/10/2020	-	-	-	None	-	-	-
1048-1	Art Room 20 @A	SK	App	1.03	12/10/2020	-	-	-	None	-	-	-
1048-2	Art Room 20 @B	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1048-3	Art Room 20 @C	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1049-1	Hallway by Storage 3	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1049-2	Hallway by Storage 3	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1050-1	Boys Bathroom by Storage 3 @A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1050-2	Boys Bathroom by Storage 3 @B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1050-3	Boys Bathroom by Storage 3 @C	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1051-1	Custodial Slop Sink by Storage 3	SS	N/A		12/10/2020	-	-	-	None	Locked Door	-	-
1052-1	Girls Bathroom by Storage 3 @A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1052-2	Girls Bathroom by Storage 3 @B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1052-3	Girls Bathroom by Storage 3 @C	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1053-1	Women's Bathroom by Storage 3	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1054-1	Men's Bathroom by Storage 3	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1055-1	Room 22	SK	App	1.4	12/10/2020	-	-	-	None	-	-	-
1055-2	Room 22	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1056-1	Room 23	SK	App	2.49	12/10/2020	-	-	-	None	-	-	-
1056-2	Room 23	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1057-1	Room 24	SK	App	1.07	12/10/2020	-	-	-	None	-	-	-
1057-2	Room 24	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1058-1	Room 25	SK	App	1.29	12/10/2020	-	-	-	None	-	-	-
1058-2	Room 25	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1059-1	Room 26	SK	App	2.82	12/10/2020	-	-	-	None	-	-	-
1059-2	Room 26	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1060-1	Boys Bathroom by Room 27 @A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1060-2	Boys Bathroom by Room 27 @B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1061-1	Girls Bathroom by Room 27 @A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1061-2	Girls Bathroom by Room 27 @B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1062-1	Custodial Slop Sink by Room 27	SS	N/A		12/10/2020	-	-	-	None	Locked Door	-	-
1063-1	Hallway by Room 27	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1063-2	Hallway by Room 27	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1064-1	Room 27 Unit A (Left)	SK	N/A		12/10/2020	-	-	-	None	Removed From Service	-	-
1064-2	Room 27 Unit A (Right)	SK	App	2.59	12/10/2020	-	-	-	None	-	-	-
1064-3	Room 27 Unit B	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1065-1	Room 28 Unit A	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1065-2	Room 28 Unit B (Left)	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1065-3	Room 28 Unit B (Right)	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1066-1	Room 29	SK	App	1.36	12/10/2020	-	-	-	None	-	-	-
1067-1	Room 30	SK	App	1.31	12/10/2020	-	-	-	None	-	-	-
1068-1	Bathroom by Room 30	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1069-1	Room 31	SK	App	1.32	12/10/2020	-	-	-	None	-	-	-
1070-1	Girls Locker Room Coach's Office Bathroom	SK	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1070-2	Girls Locker Room Bathroom @A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1070-3	Girls Locker Room Bathroom @B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1070-4	Girls Locker Room Custodial Slop Sink	SS	N/A		12/10/2020	-	-	-	Sign Required	-	-	-
1071-1	Hallway by Stage	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
1071-2	Hallway by Stage	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
1072-1	Security Office Bathroom	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1072-2	Security Office Custodial Slop Sink	SS	N/A		12/10/2020	-	-	-	None	Locked Door	-	-
1073-1	Boys Locker Room Coach's Office Bathrooms	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1073-2	Boys Locker Room Bathroom @A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1073-3	Boys Locker Room Bathroom @B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2001-1	Room 40	SK	App	<1.0	12/10/2020	-	-	-	None	-	-	-
2001-2	Room 40	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
2001-3	Room 40	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
2002-1	Room 044	SK	App	9.17	12/10/2020	-	-	-	None	-	-	-
2002-2	Room 044	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
2003-1	Room 045	SK	App	4.96	12/10/2020	-	-	-	None	-	-	-
2003-2	Room 045	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
2004-1	Room 041	SK	App	15.4	12/10/2020				None	Aerator Cleaned	5.96	12/24/2020
2004-2	Room 041	WF	App		12/10/2020				None	Removed From Service		
2005-1	Room 042	SK	App	12.3	12/10/2020	-	-	-	None	-	-	-
2005-2	Room 042	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
2006-1	Room 043	SK	App	12	12/10/2020	-	-	-	None	-	-	-
2006-2	Room 043	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
2007-1	Womens Bathroom by Room 057	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2008-1	Girls Bathroom by Room 057 @A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2008-2	Girls Bathroom by Room 057 @B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2008-3	Girls Bathroom by Room 057 @C	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2009-1	Custodial Slop Sink by Room 057	SS	N/A		12/10/2020	-	-	-	None	Locked Door	-	-
2010-1	Boys Bathroom by Room 057 @A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2010-2	Boys Bathroom by Room 057 @B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2010-3	Boys Bathroom by Room 057 @C	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2011-1	Hallway by Storage 4	WF	App	<1.0	9/2/2020	-	-	-	None	Removed From Service	-	-
2011-2	Hallway by Storage 4	BF	App	<1.0	9/2/2020	-	-	-	None	-	-	-
2012-1	Room 046	SK	App	15.3	12/10/2020				Additional Sampling Required	Aerator Cleaned	5.26	12/24/2020
2012-2	Room 046	WF	App		12/10/2020				None	Removed From Service		
2013-1	Room 047	SK	App	22.9	12/24/2020	<1.0	<1.0	12/24/2020	FR	Fixture Replaced	2.59	1/22/2021
2013-2	Room 047	WF	App		12/10/2020				None	Removed From Service		
2014-1	Room 048	SK	App	290	12/24/2020	99.4	3.71	12/24/2020	FRSLV	Fixture, Supply line and Valve Replaced	<1.0	1/22/2021
2014-2	Room 048	WF	App		12/10/2020				None	Removed From Service		
2015-1	Room 049	SK	App	26.7	12/10/2020				Additional Sampling Required	Aerator Cleaned	6.28	12/24/2020
2015-2	Room 049	WF	App		12/10/2020				None	Removed From Service		
2016-1	Room 050	SK	App	1.93	12/10/2020	-	-	-	None	-	-	-
2016-2	Room 050	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
2017-1	Men's Bathroom by Room 056	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2018-1	Girls Bathroom by Room 056 @A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2018-2	Girls Bathroom by Room 056 @B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2018-3	Girls Bathroom by Room 056 @C	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2019-1	Custodial Slop Sink by Room 056	SS	N/A		12/10/2020	-	-	-	None	Locked Door	-	-
2020-1	Boys Bathroom by Room 056 @A	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2020-2	Boys Bathroom by Room 056 @B	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2020-3	Boys Bathroom by Room 056 @C	SK	N/A		12/10/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2021-1	Hallway by Storage 5	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
2021-2	Hallway by Storage 5	BF	App	<1.0	12/10/2020	-	-	-	None	-	-	-
2022-1	Room 051	SK	App	3.54	12/10/2020	-	-	-	None	-	-	-
2022-2	Room 051	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
2023-1	Room 052	SK	App	9.27	12/10/2020	-	-	-	None	-	-	-
2023-2	Room 052	WF	App		12/10/2020	-	-	-	None	Removed From Service	-	-
2024-1	Room 053	SK	App	63.4	12/10/2020				Additional Sampling Required	Aerator Cleaned	2.88	12/24/2020
2024-2	Room 053	WF	App		12/10/2020				None	Removed From Service		
2025-1	Room 054	SK	App	20.9	12/24/2020	<1.0	1.3	12/24/2020	FR	Fixture Replaced	1.88	1/22/2021
2025-2	Room 054	WF	App		12/10/2020				None	Removed From Service		
2026-1	Room 055	SK	App	10.2	12/10/2020	-	-	-	None	-	-	-

Laboratory Report

NYE Report #: 2205004-16460

December 15, 2020

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Shelter Rock Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on December 14, 2020. New York Environmental analyzed the samples on December 14, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	10 Dec 2020
Date Received:	14 Dec 2020
Date Analyzed:	14 Dec 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201214I158	1	Kitchen Dishwash Station @A -SK; Initial	1.00	<1.00	µg/L	
201214I159	2	Kitchen Dishwash Station @B -SPY; Initial	1.00	<1.00	µg/L	
201214I160	3	Kitchen Food Prep Station @A-SK; Initial	1.00	<1.00	µg/L	
201214I161	4	Kitchen Food Prep Station @B-SK; Initial	1.00	<1.00	µg/L	
201214I162	5	Kitchen Pot Filler-PF; Initial	1.00	2.47	µg/L	
201214I163	6	Music Room 33-SK; Initial	1.00	<1.00	µg/L	
201214I164	7	Room 33-SK; Initial	1.00	1.21	µg/L	
201214I165	8	Special Ed Office 32-SK; Initial	1.00	<1.00	µg/L	
201214I166	9	Hallway by Special Ed Office 32-BF; Initial	1.00	<1.00	µg/L	
201214I167	10	Teachers Lounge-SK; Initial	1.00	<1.00	µg/L	
201214I168	11	Room 40-SK; Initial	1.00	<1.00	µg/L	
201214I169	12	Room 40-BF; Initial	1.00	<1.00	µg/L	
201214I170	13	Science Room Kitchenette -SK; Initial	1.00	<1.00	µg/L	
201214I171	14	Science Room @B-SK; Initial	1.00	<1.00	µg/L	
201214I172	15	Nurses Office -SK; Initial	1.00	<1.00	µg/L	
201214I173	16	Hallway by Room 01A-BF; Initial	1.00	<1.00	µg/L	
201214I174	17	Room 001-SK; Initial	1.00	<1.00	µg/L	
201214I175	18	Room 002-SK; Initial	1.00	<1.00	µg/L	
201214I176	19	Room 004-SK; Initial	1.00	1.04	µg/L	
201214I177	20	Room 005-SK; Initial	1.00	<1.00	µg/L	
201214I178	21	Room 006-SK; Initial	1.00	1.72	µg/L	
201214I179	22	Room 007-SK; Initial	1.00	<1.00	µg/L	
201214I180	23	Room 008-SK; Initial	1.00	<1.00	µg/L	
201214I181	24	Room 09-SK; Initial	1.00	<1.00	µg/L	
201214I182	25	Room 10-SK; Initial	1.00	<1.00	µg/L	
201214I183	26	Room 11-SK; Initial	1.00	<1.00	µg/L	

Date Collected:	10 Dec 2020
Date Received:	14 Dec 2020
Date Analyzed:	14 Dec 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201214I184	27	Room 12-SK; Initial	1.00	<1.00	µg/L	
201214I185	28	Room 13-SK; Initial	1.00	1.07	µg/L	
201214I186	29	Room 14-SK; Initial	1.00	1.67	µg/L	
201214I187	30	Room 15-SK; Initial	1.00	3.64	µg/L	
201214I188	31	Room 16-SK; Initial	1.00	1.32	µg/L	
201214I189	32	Room 21-SK; Initial	1.00	1.14	µg/L	
201214I190	33	Library -SK; Initial	1.00	2.63	µg/L	
201214I191	34	Art Room 20 @A-SK; Initial	1.00	1.03	µg/L	
201214I192	35	Art Room 20 @B-SK; Initial	1.00	<1.00	µg/L	
201214I193	36	Art Room 20 @C-SK; Initial	1.00	<1.00	µg/L	
201214I194	37	Hallway by Storage 3-BF; Initial	1.00	<1.00	µg/L	
201214I195	38	Room 22-SK; Initial	1.00	1.40	µg/L	
201214I196	39	Room 23-SK; Initial	1.00	2.49	µg/L	
201214I197	40	Room 24-SK; Initial	1.00	1.07	µg/L	
201214I198	41	Room 25-SK; Initial	1.00	1.29	µg/L	
201214I199	42	Room 26-SK; Initial	1.00	2.82	µg/L	
201214I200	43	Hallway by Room 27-BF; Initial	1.00	<1.00	µg/L	
201214I201	44	Room 27 Unit A (Right)-SK; Initial	1.00	2.59	µg/L	
201214I202	45	Room 27 Unit B-SK; Initial	1.00	<1.00	µg/L	
201214I203	46	Room 28 Unit A-SK; Initial	1.00	<1.00	µg/L	
201214I204	47	Room 28 Unit B (Left)-SK; Initial	1.00	<1.00	µg/L	
201214I205	48	Room 28 Unit B (Right)-SK; Initial	1.00	<1.00	µg/L	
201214I206	49	Room 29-SK; Initial	1.00	1.36	µg/L	
201214I207	50	Room 30-SK; Initial	1.00	1.31	µg/L	
201214I208	51	Room 31-SK; Initial	1.00	1.32	µg/L	
201214I209	52	Hallway by Stage-BF; Initial	1.00	<1.00	µg/L	
201214I210	53	Room 044-SK; Initial	1.00	9.17	µg/L	

Date Collected:	10 Dec 2020
Date Received:	14 Dec 2020
Date Analyzed:	14 Dec 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201214I211	54	Room 045-SK; Initial	1.00	4.96	µg/L	
201214I212	55	Room 041-SK; Initial	1.00	15.4	µg/L	H
201214I213	56	Room 042-SK; Initial	1.00	12.3	µg/L	
201214I214	57	Room 043-SK; Initial	1.00	12.0	µg/L	
201214I215	58	Hallway by Storage 5-BF; Initial	1.00	<1.00	µg/L	
201214I216	59	Room 046-SK; Initial	1.00	15.3	µg/L	H
201214I217	60	Room 047-SK; Initial	1.00	32.1	µg/L	H
201214I218	61	Room 048-SK; Initial	1.00	245	µg/L	E,H
201214I219	62	Room 049-SK; Initial	1.00	26.7	µg/L	H
201214I220	63	Room 050-SK; Initial	1.00	1.93	µg/L	
201214I221	64	Room 051-SK; Initial	1.00	3.54	µg/L	
201214I222	65	Room 052-SK; Initial	1.00	9.27	µg/L	
201214I223	66	Room 053-SK; Initial	1.00	63.4	µg/L	E,H
201214I224	67	Room 054-SK; Initial	1.00	42.2	µg/L	H
201214I225	68	Room 055-SK; Initial	1.00	10.2	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

Laboratory Report

NYE Report #: 2205137-16551

December 29, 2020

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Shelter Rock Elementary, Manhasset, NY

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on December 24, 2020. New York Environmental analyzed the samples on December 28, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	24 Dec 2020
Date Received:	24 Dec 2020
Date Analyzed:	28 Dec 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201224J008	1	Room 041-SK; Initial	1.00	5.96	µg/L	
201224J009	2	Room 046-KS; Initial	1.00	5.26	µg/L	
201224J010	3	Room 047-SK; Initial	1.00	22.9	µg/L	H
201224J011	4	Room 048-SK; Initial	1.00	290	µg/L	E,H
201224J012	5	Room 049-SK; Initial	1.00	6.28	µg/L	
201224J013	6	Room 053-SK; Initial	1.00	2.88	µg/L	
201224J014	7	Room 054-SK; Initial	1.00	20.9	µg/L	H
2012281017	3A	Room 047-SK; Follow-up (1)	1.00	<1.00	µg/L	
201228101A	3B	Room 047-SK; Follow-up (2)	1.00	<1.00	µg/L	
2012281018	4A	Room 048-SK; Follow-up (1)	1.00	99.4	µg/L	E,H
201228101B	4B	Room 048-SK; Follow-up (2)	1.00	3.71	µg/L	
2012281019	7A	Room 054-SK; Follow-up (1)	1.00	<1.00	µg/L	
201228101C	7B	Room 054-SK; Follow-up (2)	1.00	1.30	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

Laboratory Report

NYE Report #: 2210312-16762

January 25, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Shelter Rock Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on January 22, 2021. New York Environmental analyzed the samples on January 25, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	22 Jan 2021
Date Received:	22 Jan 2021
Date Analyzed:	25 Jan 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210122I007	1	Room 047-KS; Initial	1.00	2.59	µg/L	
210122I008	2	Room 048-SK; Initial	1.00	<1.00	µg/L	
210122I009	3	Room 054-SK; Initial	1.00	1.88	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation